


V2 Fuel Tank Installation note:

The fuel sending unit float can interfere with the newly installed tank one way doors if not modified. The OEM fuel float is positioned to the rear of the tank in top view. The new tank requires that the float rod be realigned to the center of the tank in top view. This can be easily accomplished by bending the float rod so that the float is positioned in the center of the tank in top view.

Caution! There is a coupling that is welded in the center of the float rod. DO NOT! bend the rod in this area. The OEM welding process has made the rod very brittle in this area and can easily fracture the rod is deformed in that area.

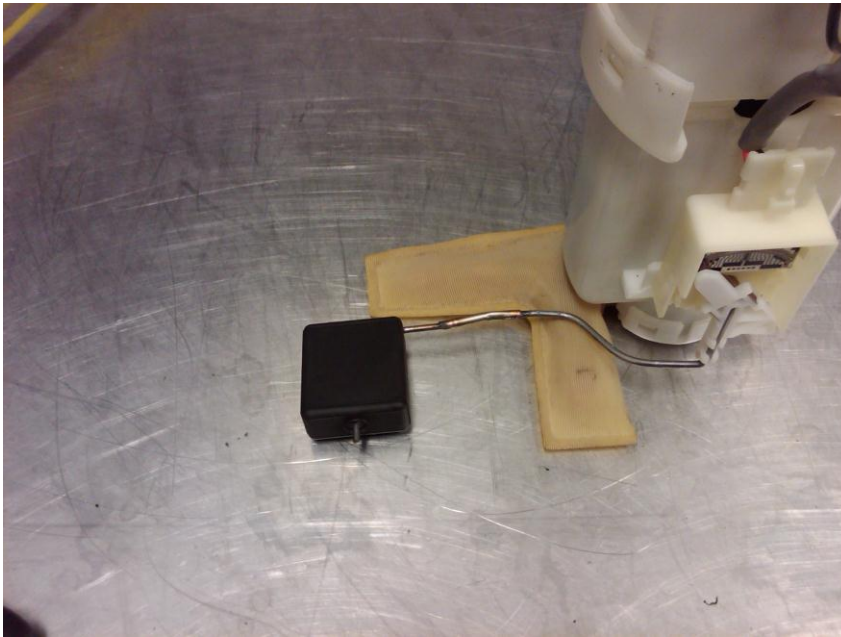

If you have any questions about this modification please do not hesitate to call or email me.

Ralph Provitz

586-822-8806

38bfast@comcast.net

